


NO	NOTES	NO.	NOTES												
1.	COLOR CODE: BK - BLACK W - WHITE R - RED G - GREEN O - ORANGE BL - BLUE Y - YELLOW BR - BROWN P - PURPLE S - SLATE	7.	ACCESSORY GROUP												
2.	X DENOTES SPLICED, SOLDERED, AND TAPED WIRES.		ACCESS. GROUP NO. COPYLIGHT SYSTEM MARGIN IND. LAMP												
3.	COMPONENTS SHOWN DOTTED ARE ACCESSORIES TO CABINET.		130, 137, 150 X X												
4.	USE POWER AND SIGNAL LINE INTERFERENCE SUPPRESSORS FOR INSTALLATIONS REQUIRING MINIMUM R.F. INTERFERENCE. FOR OTHER INSTALLATIONS, OMIT SUPPRESSORS AND CONNECT INPUTS DIRECTLY TO TERMINALS SHOWN.		148, 149, 194 X X 195												
5.	CABINET POWER CIRCUIT WIRED FOR 115 V. D.C. OPERATION. CONNECT GROUNDED SIDE OF INPUT POWER, OR NEGATIVE SIDE OF UNGROUNDED POWER TO TERMINAL C40 OR THROUGH THIS SIDE OF FILTER. POLARITIES SHOWN (+) AND (-) ARE FOR NEGATIVE GROUNDED POWER. THE ASSOCIATED ELECTRICAL SERVICE UNIT MUST BE WIRED FOR D.C. OPERATION SELECT THE DESIRED OPERATING CONDITIONS FROM THE FOLLOWING TABLE AND MAKE CONNECTIONS AT THE CABINET TERMINAL BLOCKS WITH THE TWO 153483 STRAPS FURNISHED WITH THE 152624 A.C. TO D.C. ASSEMBLY : SIGNAL LINE CIRCUIT ACCESSORY OPERATION.		(CORDS AND GROUND STRAP FURNISHED BY CUSTOMER)												
	<table border="1"> <thead> <tr> <th></th> <th>OPERATES CONTINUOUSLY</th> <th>OPERATES WITH POWER SWITCH</th> <th>OPERATES WITH MOTOR CONTROL</th> </tr> </thead> <tbody> <tr> <td>POWER SOURCE</td> <td> NEGATIVE GROUND OR UNGROUNDED C 21 - C 38 C 22 - C 40 </td> <td> C 21 - C 35 C 22 - C 40 </td> <td> C 21 - C 37 C 22 - C 40 </td> </tr> <tr> <td></td> <td> POSITIVE GROUND C 22 - C 38 C 21 - C 40 </td> <td> C 22 - C 35 C 21 - C 40 </td> <td> C 22 - C 37 C 21 - C 40 </td> </tr> </tbody> </table> SEE APPROPRIATE ELECTRICAL SERVICE UNIT SCHEMATIC WIRING DIAGRAM.		OPERATES CONTINUOUSLY	OPERATES WITH POWER SWITCH	OPERATES WITH MOTOR CONTROL	POWER SOURCE	NEGATIVE GROUND OR UNGROUNDED C 21 - C 38 C 22 - C 40	C 21 - C 35 C 22 - C 40	C 21 - C 37 C 22 - C 40		POSITIVE GROUND C 22 - C 38 C 21 - C 40	C 22 - C 35 C 21 - C 40	C 22 - C 37 C 21 - C 40		<p>Diagram illustrating the connection of a power source to cabinet terminal blocks. The power source is connected to terminals C21-C38 and C22-C40. A ground connection (GND) is also shown. The input signal line (IN) is connected to the power source.</p>
	OPERATES CONTINUOUSLY	OPERATES WITH POWER SWITCH	OPERATES WITH MOTOR CONTROL												
POWER SOURCE	NEGATIVE GROUND OR UNGROUNDED C 21 - C 38 C 22 - C 40	C 21 - C 35 C 22 - C 40	C 21 - C 37 C 22 - C 40												
	POSITIVE GROUND C 22 - C 38 C 21 - C 40	C 22 - C 35 C 21 - C 40	C 22 - C 37 C 21 - C 40												
6.	NECESSARY STRAP CONNECTIONS AT THE CABINET TERMINAL BLOCKS ARE SHOWN ON THE ASSOCIATED ELECTRICAL SERVICE UNIT WIRING DIAGRAM. SEE THE LESU7 ACCESSORY GROUP B.M. FOR THE DIAGRAM NUMBER.		<p>Diagram illustrating the connection of a power source to cabinet terminal blocks. The power source is connected to terminals C21-C38 and C22-C40. A ground connection (GND) is also shown. The input signal line (IN) is connected to the power source.</p>												

(CONTINUED ON BACK)

NOTE: SEE NOTES 4 AND 5

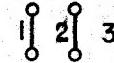


NOTES


ACCESSORY GROUP ASSIGNMENTS

HT	MARGIN IND. LAMP	SIGNAL BELL	ELEC. NOISE SUPPRESSORS		
	X	X			
	X	X	X		

MARGIN LAMP SEE
INDICATOR SOCKET NOTE 7


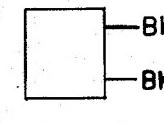


COPYLIGHTING SYSTEM SEE

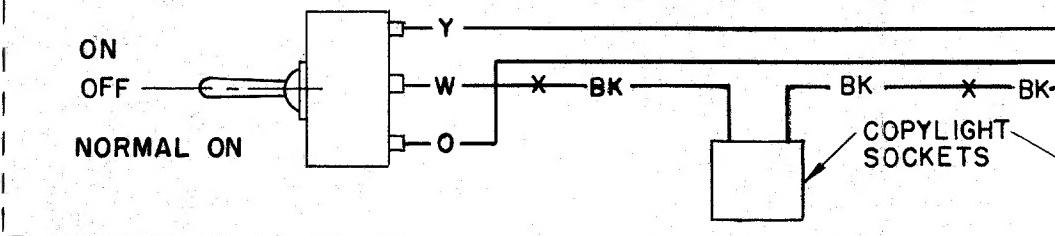

AND GROUND FURNISHED BY CUSTOMER)

TOP TERM. POSITIVE

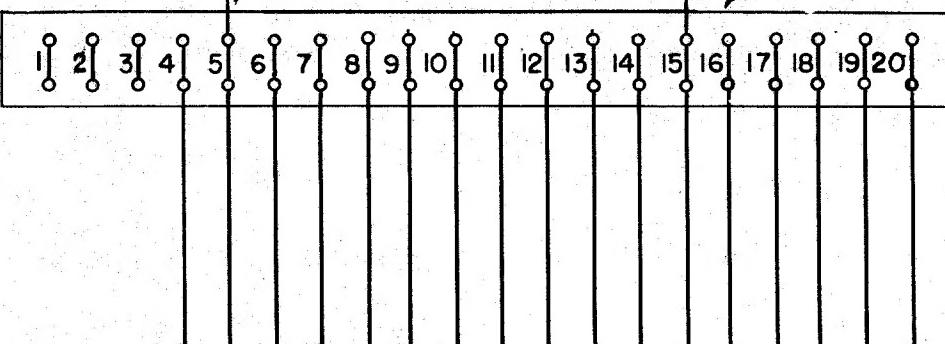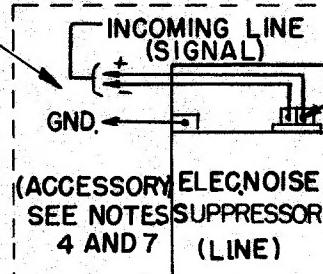

(CORDS AND GR STRAP FURNISHED BY CUSTOMER)

SIGNAL BE SEE NO

CORDS FURNISHED BY CUSTOMER

REPERFORATOR CONTROL

REMOTE - OFF LINE STUNT SHIFT


BK BK

SEE APPROPRIATE ELECTRICAL SERVICE UNIT WIRING DIAGRAM

(AS INDICATED ON THE LESU7 ACCESSORY GROUP B.M.)

FOR SCHEMAT


MARGIN INDICATOR
LAMP SOCKET
SEE NOTE 7

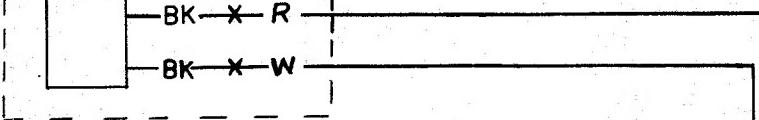

REVISIONS

A	1-14-55	28-4814
B	1-22-55	28-4921
C	1-25-55	28-4869
D	7-8-55	28-5583
E	8-13-55	28-5607
F	7-13-56	28-6816

LIGHTING SYSTEM SEE NOTE 7

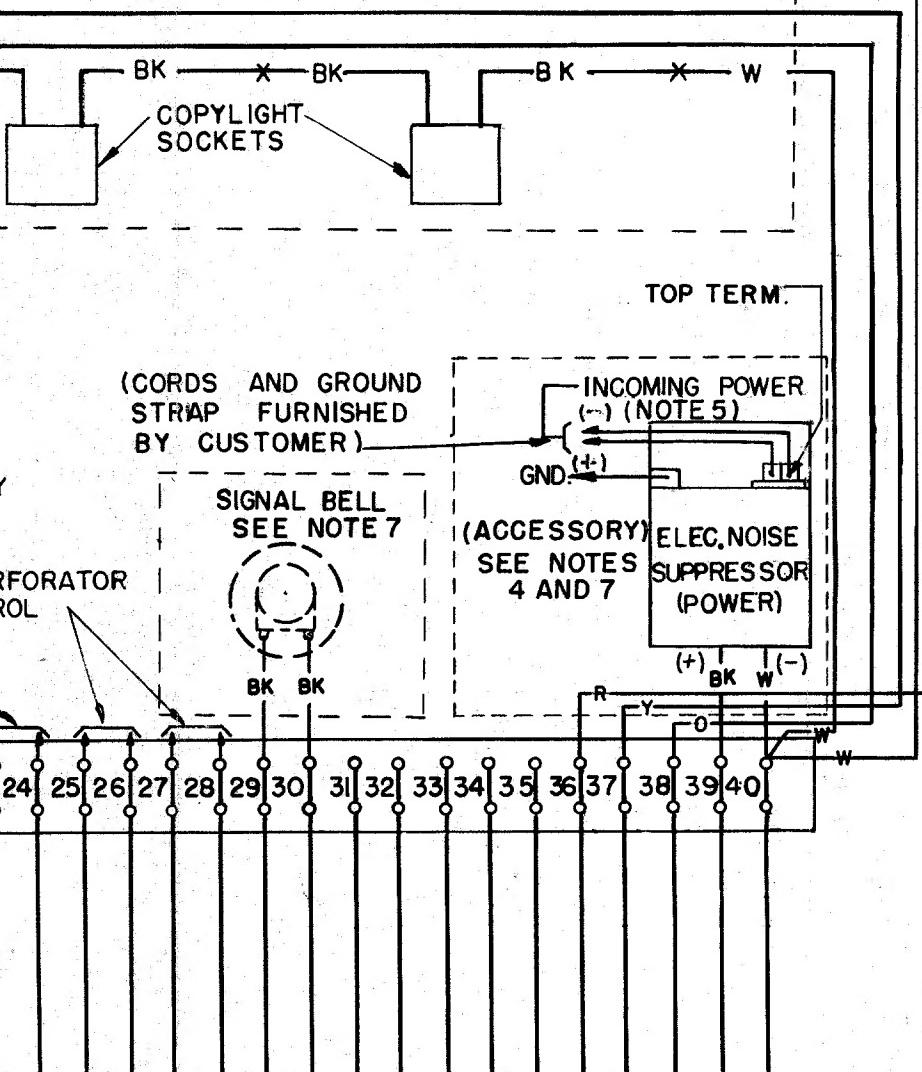

2876 WD
4-20-54

ACTUAL
WIRING DIAGRAM
FOR MODEL 28
PRINTER CABINET
LAC 203,204,205

ACCESSORY GROUPS
130, 137, 148, 149, 150
194, 195

DRAWN: N.K.G. APPROVED: *JTB*

ENG'D: G.A.O.

CHECKED: *ST*

FILE: 2-30-65-156A

TELETYPE
CORPORATION

WIRING DIAGRAM

3.M.)

FOR SCHEMATIC SEE ASSOCIATED LESU WD.